

AD-A122 294      ROLE OF SURFACE OXIDE ON GUN BARREL WEAR(U) ARMY  
ARMAMENT RESEARCH AND DEVELOPMENT COMMAND ABERDEEN  
PROV. J R HWARD ET AL. NOV 82 ARBRL-TR-82437      1/1

UNCLASSIFIED      SBI-AD-F300 114

F/G 19/6


NL

END

FILMED

RECORDED

DTIC

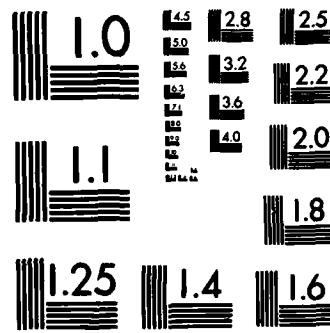

MICROCOPY RESOLUTION TEST CHART  
NATIONAL BUREAU OF STANDARDS-1963-A

AD A 122294

AD

TECHNICAL REPORT ARBRL-TR-02437

ROLE OF SURFACE OXIDE ON GUN BARREL WEAR

J. Richard Ward  
Robert P. Kaste  
Irvin C. Stobie  
Bruce D. Bensinger

November 1982



US ARMY ARMAMENT RESEARCH AND DEVELOPMENT COMMAND  
BALLISTIC RESEARCH LABORATORY  
ABERDEEN PROVING GROUND, MARYLAND

Approved for public release; distribution unlimited.

MIC FILE COPY  
MIC

82 11 03 009

Destroy this report when it is no longer needed.  
Do not return it to the originator.

Secondary distribution of this report is prohibited.

Additional copies of this report may be obtained  
from the National Technical Information Service,  
U. S. Department of Commerce, Springfield, Virginia  
22161.

The findings in this report are not to be construed as  
an official Department of the Army position, unless  
so designated by other authorized documents.

*The use of trade names or manufacturers' names in this report  
does not constitute endorsement of any commercial product.*

## UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER Technical Report ARBRL-TR-02437	2. GOVT ACCESSION NO. <i>AD-A122294</i>	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) ROLE OF SURFACE OXIDE ON GUN BARREL WEAR	5. TYPE OF REPORT & PERIOD COVERED	
	6. PERFORMING ORG. REPORT NUMBER	
7. AUTHOR(s) J.R. Ward, R.P. Kaste, I.C. Stobie, and B.D. Bensinger	8. CONTRACT OR GRANT NUMBER(s)	
9. PERFORMING ORGANIZATION NAME AND ADDRESS USA Ballistic Research Laboratory ATTN: DRDAR-BLI Aberdeen Proving Ground, MD 21005	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS RDT&E 1L161102AH43	
11. CONTROLLING OFFICE NAME AND ADDRESS US Army Armament Research & Development Command US Army Ballistic Research Laboratory (DRDAR-BL) Aberdeen Proving Ground, MD 21005	12. REPORT DATE November 1982	
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)	13. NUMBER OF PAGES 26	
	15. SECURITY CLASS. (of this report) <b>UNCLASSIFIED</b>	
	15a. DECLASSIFICATION/DOWNGRADING SCHEDULE	
16. DISTRIBUTION STATEMENT (of this Report) Approved for public release; distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Iron Oxide Gun Barrel Wear Gun Propellant Blowout Gun		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) <i>raj</i> Earlier analysis of gun tubes and steel nozzles exposed to propellant combustion gases showed that a tenacious oxide layer is left on the surface after firing. The thickness of the oxide layer was inversely proportional to the flame temperature of the propellant. Experiments were performed in a 37-mm blowout gun to determine whether the oxide layer influences wear. The experiments were performed with a nozzle that had been conditioned with M1, M30, M5, or M8 propellant. The results showed the oxide layer insulates the		

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)


Abstract (Cont'd):

20. steel and reduces erosion. The wear with M8 propellant decreased as the flame temperature of the propellant used for the previous shot decreased. Conversely, the wear with M1 propellant increased as the flame temperature of the propellant from the previous shot increased.

These results show the Effective Full Charge (EFC) factors determined from standard wear tests may not predict total wear when rounds with different propellants are fired in combination. These results also suggest that if propellants with comparable flame temperatures produce different oxide thicknesses, the wear could be significantly greater for the propellant with the thinner oxide layer.

The oxide layer effect was shown in imbedded thermocouple tests in a 105-mm tank gun. The heat transfer was higher in an M392A2 round preceded by an M490 without a liner than a M392A2 preceded by an M467. The M467 conditions the barrel with a thicker oxide layer. A similar trend was shown with M490 rounds with conditioning rounds that had different oxide thicknesses.

The oxide layer effect was used to explain abnormally high wear in a study where M392A2 rounds and M467 rounds were fired alternately. The total wear was twice as great as predicted by the correlation of heat transfer from the M392A2 and the wear from a wear test of M467 TP-T rounds.

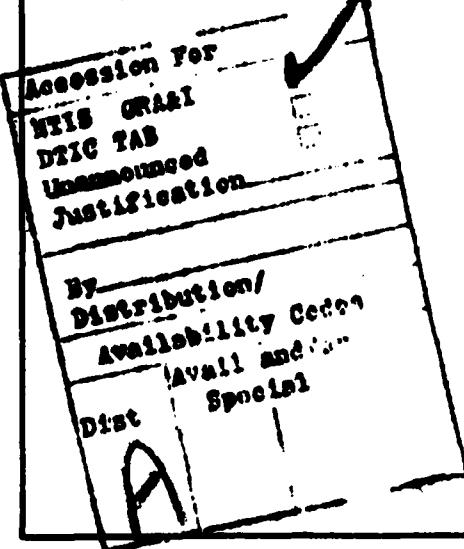

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

## TABLE OF CONTENTS

	PAGE
LIST OF TABLES.....	5
I. INTRODUCTION.....	7
II. EXPERIMENTAL.....	7
III. RESULTS AND DISCUSSION.....	8
IV. CONCLUSIONS.....	15
REFERENCES.....	16
APPENDIX A.....	17
DISTRIBUTION LIST.....	23

## LIST OF TABLES

TABLE	PAGE
1. OXYGEN CONCENTRATION PROFILES ON STEEL EXPOSED TO PROPELLANTS WITH DIFFERENT FLAME TEMPERATURES.....	7
2. COMPOSITIONS OF PROPELLANTS.....	11
3. SUMMARY OF THERMOCHEMICAL PROPERTIES AND COMBUSTION GASES OF PROPELLANTS.....	11
4. EFFECT OF SURFACE OXIDE ON WEAR WITH M8 PROPELLANT....	12
5. EFFECT OF SURFACE OXIDE ON WEAR WITH M1 PROPELLANT....	12
6. EFFECT OF OXIDE COATING ON WEAR WITH M5 PROPELLANT....	12
7. EFFECT OF SURFACE OXIDE ON WEAR WITH M30 PROPELLANT...13	
8. EFFECT OF CLEANOUT ROUND ON HEAT INPUT FROM M392 CARTRIDGE.....	14
9. EFFECT OF CLEANOUT ROUND ON HEAT INPUT.....	14
A-1. MASS LOSS FOR M8 (REPETITIVE FIRE).....	19
A-2. MASS LOSS FOR M30 PROPELLANT (REPETITIVE FIRE).....	19
A-3. MASS LOSS FOR M1 PROPELLANT (REPETITIVE FIRE).....	20
A-4. MASS LOSS ALTERNATING M8 WITH M30, M5, OR M1 PROPELLANT.....	20
A-5. MASS LOSS ALTERNATING M1, M5 OR M30 PROPELLANT.....	21

## I. INTRODUCTION

Earlier analysis<sup>1,2</sup> of steel nozzles exposed to propellant combustion gases showed that a tenacious oxide layer is left on the surface. The thickness of the oxide layer was inversely proportional to the propellant's flame temperature as illustrated in Table 1. If this oxide layer affects the subsequent round, it is conceivable that wear produced from firing rounds with different propellants will be much different than that expected from EFC factors determined from wear tests where rounds with a given propellant are fired continuously.

TABLE 1. OXYGEN CONCENTRATION PROFILES ON STEEL EXPOSED TO PROPELLANTS WITH DIFFERENT FLAME TEMPERATURES

<u>Propellant</u>	<u>Flame Temperature, K</u>	<u>Oxygen, atoms/cm<sup>2</sup>, x 10<sup>-16</sup></u>
M2	3,375	9
M30	2,994	17
M1	2,480	34

In order to determine if wear was influenced by firing combinations of propellants with different flame temperatures, tests were run in a 37-mm blowout gun with M1, M30, M5 and M8 propellants. In one set of tests, M8 was fired alternately with another propellant to see the effect when the nozzle had a thin oxide coating. A second set of tests was run with M1 propellant to see the effect when the nozzle had a thick oxide deposit. The wear in these sets of tests was compared with wear from repeated shots with M8 or M1 propellant.

## II. EXPERIMENTAL

The compositions of the four propellants used in the wear tests are listed in Table 2. Thermochemical properties computed by the BLAKE code<sup>3</sup> are listed in Table 3 where

<sup>1</sup>A. Niiler, J.E. Youngblood, S.E. Caldwell, and T.J. Rock, "An Accelerator Technique for the Study of Ballistic Surfaces," BRL Report No. 1815, August 1975.

<sup>2</sup>A. Niiler and R. Birkmire, "Composition Changes in Gun Steel Surfaces Due to Erosive Propellant Burn," Proceedings of the Tri-Service Gun Tube Wear and Erosion Symposium, Dover, NJ, March 1977.

<sup>3</sup>E. Freedman, "BLAKE - A Ballistic Thermodynamic Code Based on TIGER," Proceedings of the International Symposium on Gun Propellants, Picatinny Arsenal, Dover, NJ, October 1973.

T = flame temperature,  
F = impetus,  
 $\eta$  = co-volume,  
M = molecular weight,  
 $C_p$  = specific heat,  
 $\gamma$  = ratio of specific heats.

The wear measurements were done with a 37-mm blowout gun described earlier.<sup>4</sup> Wear was determined by weighing a contoured steel nozzle after each shot. In these experiments, the nozzle's throat diameter was 12.5 mm which gave a rupture pressure of 262 MPa (38 kpsi) with two 1.6 mm thick shear disks. Propellant charge masses were adjusted to give a closed bomb pressure of 306 MPa (44.4 kpsi) to insure shear disk rupture.

Baseline wear was determined by repetitive firings in which each propellant was fired alternately with M8, and then each propellant was fired alternately with M1 to test the effect of oxide layer on wear.

### III. RESULTS AND DISCUSSION

The individual mass losses for all tests are listed in the Appendix.

Table 4 summarizes the effect on wear of M8 propellant as the propellants with progressively lower flame temperatures and thicker oxide coatings are fired alternately. One can see that the oxide acts as an insulator with the greatest difference in M8 when M1 propellant is the conditioning round.

Table 5 summarizes the reverse experiment in which one examines the effect on M1 wear as propellants leaving thinner oxide coatings are fired alternately. Again, the trend shows that the oxide insulates the steel, the difference in wear being greatest with M8. These results are plotted in Figures 1 and 2.

Tables 6 and 7 show the results for M5 propellant and M30 propellant, illustrating that there is no significant difference in wear regardless of the propellant used on the previous round. This suggests that there is a threshold thickness in the oxide which must be exceeded before measurable differences in wear are obtained, and the thicker the oxide the more protection provided. This is entirely analogous to the role  $TiO_2$  plays in wear-reducing additives<sup>5</sup>.

---

<sup>4</sup>J.R. Ward and R.W. Geene, "Erosivity of a Nitramine Propellant with a Flame Temperature Comparable to M30 Propellant," BRL Memorandum Report No. 02926, June 1979.

<sup>5</sup>J.R. Ward and T.L. Brosseau, "Role of the Insulating Layer from  $TiO_2$ -Wax Liner in Reducing Gun Tube Wear," Proceedings of the 1980 JANNAF Propulsion Meeting, CPIA Publication 315, March 1980.

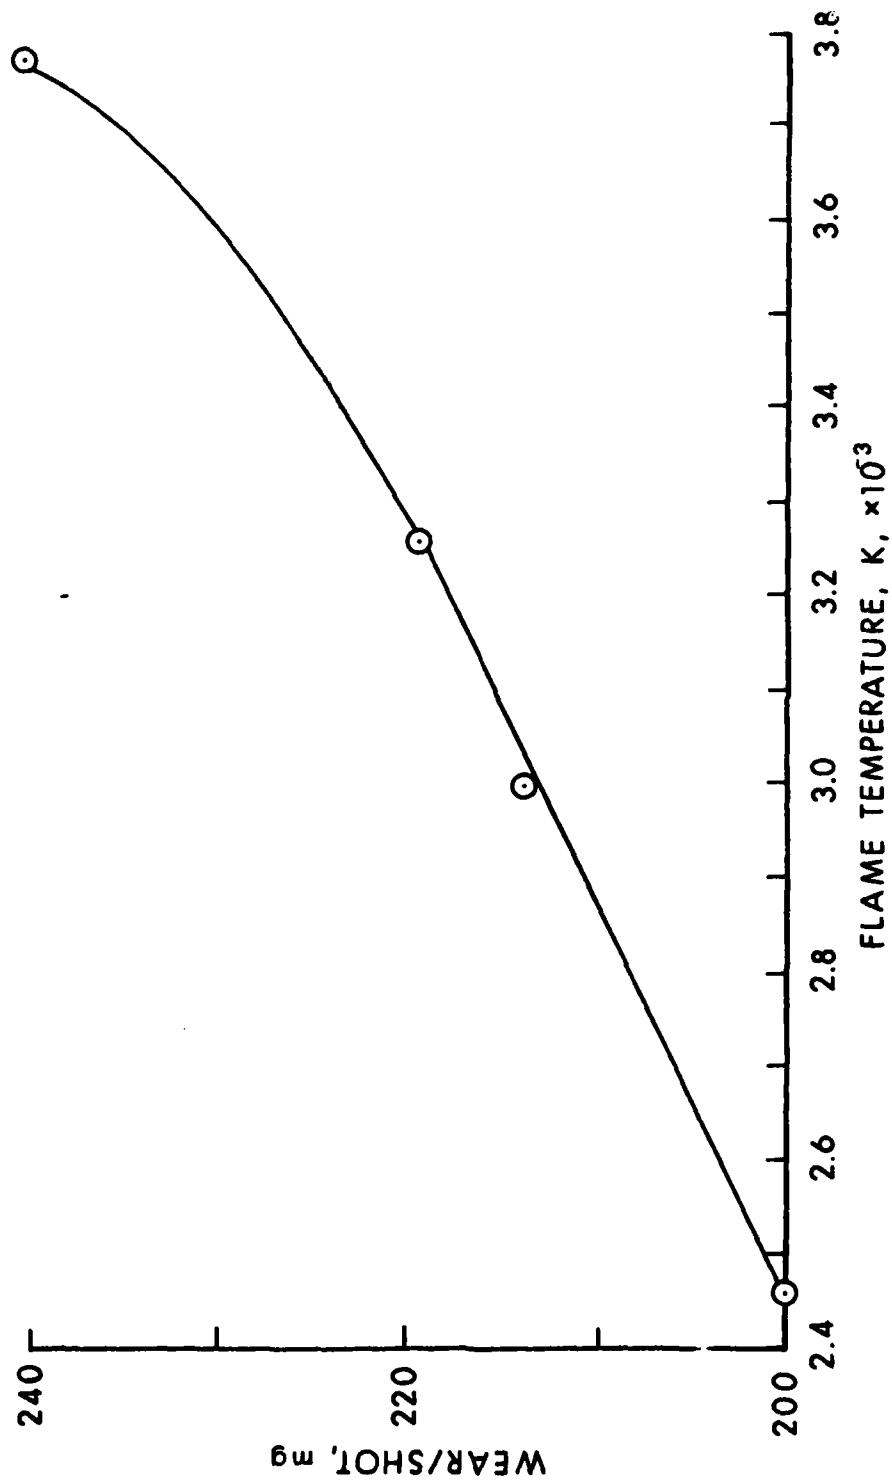


Figure 1. i3 Propellant Wear vs The Flame Temperature Of The Preceeding Round.

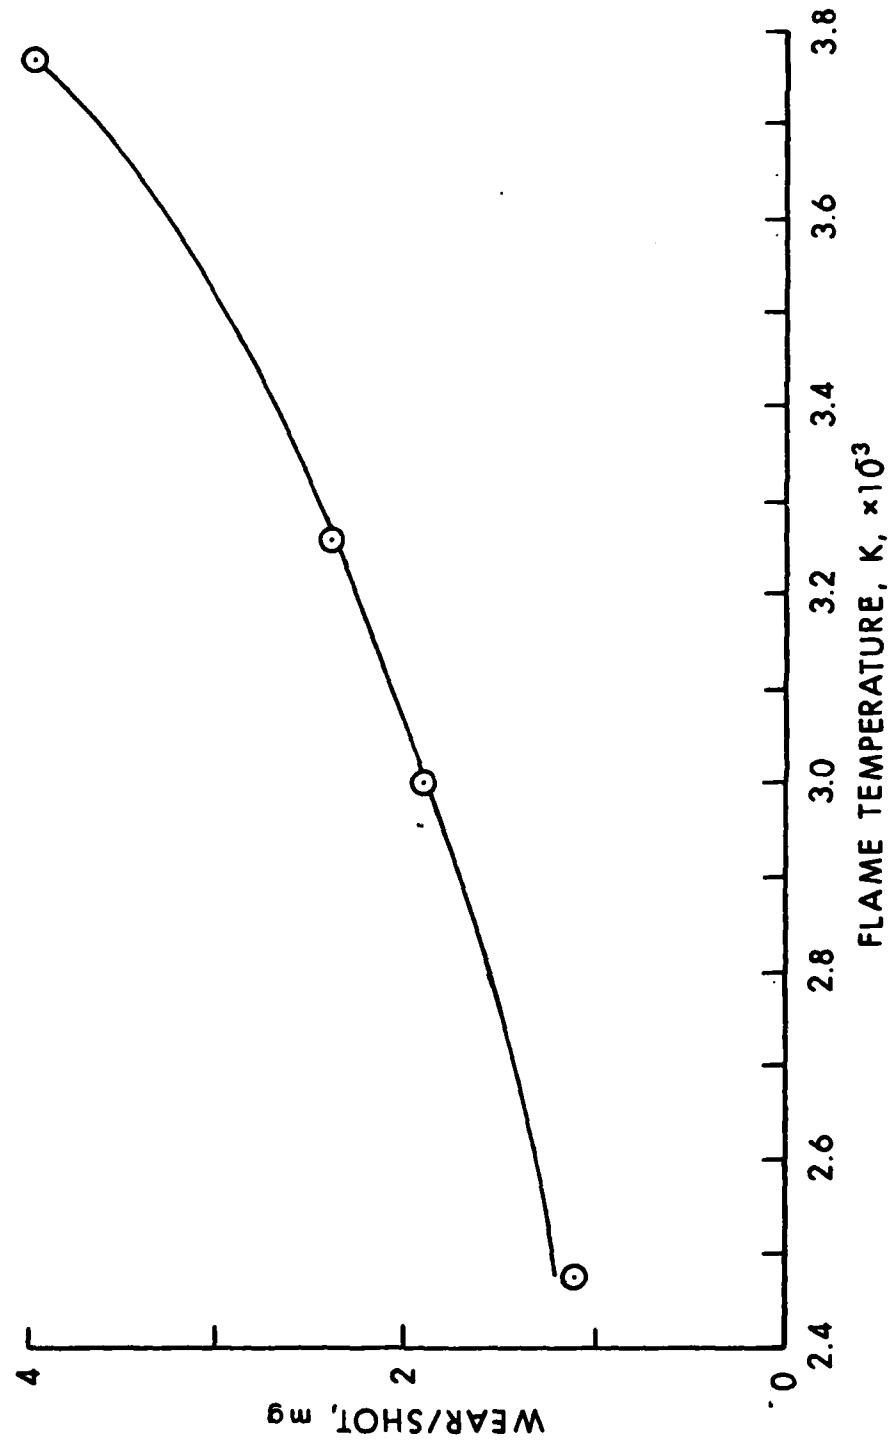


Figure 2. iii Propellant Wear vs The Flame Temperature Of The Preceding Round.

TABLE 2. COMPOSITIONS OF PROPELLANTS  
(weight percent)

	<u>M5</u>	<u>M8</u>	<u>M1</u>	<u>M30</u>
Nitrocellulose (Percent Nitrogen)	81.95 (13.25)	52.15 (13.25)	85.00 (13.25)	28.0 (12.6)
Nitroglycerine Nitroguanidine	15.00 -----	43.00 -----	----- -----	22.5 47.7
Ethyl Centralite	0.60	0.60	-----	1.5
Barium Nitrate	1.40	-----	-----	-----
Potassium Nitrate	0.75	1.25	-----	-----
Diethylphthalate	-----	3.00	-----	-----
Dinitrotoluene	-----	-----	10.0	-----
Dibutylphthalate	-----	-----	5.00	-----
Cryolite	-----	-----	-----	0.3
Diphenylamine, Added	-----	-----	1.00	-----
Ethyl Alcohol, Residual	2.30	0.40	0.75	0.2
Water, Residual	0.70	-----	0.50	-----
Graphite	0.30	-----	-----	-----

TABLE 3. SUMMARY OF THERMOCHEMICAL PROPERTIES AND COMBUSTION GASES  
OF PROPELLANTS

<u>Prop</u>	<u>Temp K</u>	<u>Force J/g</u>	<u><math>\eta</math> <math>\text{cm}^3/\text{g}</math></u>	<u>M g/mole</u>	<u>CO*</u>	<u>CO<sub>2</sub>*</u>	<u>H<sub>2</sub>O*</u>	<u>H<sub>2</sub>*</u>	<u>N<sub>2</sub>*</u>	<u>C<sub>p</sub> J/mole</u>	<u><math>\gamma</math></u>
M8	3,716	1,178	0.970	26.2	13.0	6.4	10.2	2.4	5.4	47.7	1.22
M5	3,264	1,079	1.003	25.1	16.5	4.9	9.3	4.0	4.9	45.5	1.23
M30	3,021	1,078	1.050	23.3	11.8	3.0	10.5	5.5	11.9	41.1	1.24
M1	2,480	928	1.108	22.2	22.8	2.4	6.1	9.1	4.5	41.0	1.27

\*Moles of gas/kg of propellant.

TABLE 4. EFFECT OF SURFACE OXIDE ON WEAR WITH M8 PROPELLANT

<u>Conditioning Propellant</u>	<u>Flame Temp K</u>	<u>Charge Mass, g</u>	<u>No. Shots</u>	<u>M8 Mass Loss mg/shot*</u>
M8	3,716	68.4	6	240.5 ± 15.0
M5	3,264	72.8	3	219.3 ± 5.0
M30	3,021	72.2	2	219.5 ± 8.1
M1	2,480	80.09	3	199.6 ± 14.4

\*Error expressed as sample standard deviation.

TABLE 5. EFFECT OF SURFACE OXIDE ON WEAR WITH M1 PROPELLANT

<u>Conditioning Propellant</u>	<u>Flame Temp K</u>	<u>Charge Mass, g</u>	<u>No. Shots</u>	<u>M1 Mass Loss mg/shot*</u>
M1	2,480	80.09	5	1.1 ± 0.4
M30	3,021	72.2	4	1.9 ± 1.7
M5	3,264	72.8	4	2.4 ± 1.7
M8	3,716	68.4	4	4.0 ± 0.8

\*Error expressed as sample standard deviation.

TABLE 6. EFFECT OF OXIDE COATING ON WEAR WITH M5 PROPELLANT

<u>Conditioning Propellant</u>	<u>Flame Temp, K</u>	<u>No. Shots</u>	<u>M5 Mass Loss, mg/shot*</u>
M8	3,716	3	48.6 ± 3.7
M5	3,264	5	50.7 ± 6.0
M1	2,480	3	44.2 ± 3.1

\*Error expressed as sample standard deviation.

TABLE 7. EFFECT OF SURFACE OXIDE ON WEAR WITH M30 PROPELLANT

<u>Conditioning Propellant</u>	<u>Flame Temp., K</u>	<u>No. Shots</u>	<u>M30 Mass Loss, mg/shot*</u>
M8	3,716	3	12.3 ± 5.8
M30**	3,021	7	10.8 ± 3.1
M30**	3,021	6	3.9 ± 1.1
M1	2,480	4	5.5 ± 1.3

\*Error expressed as sample standard deviation.

\*\*Different M30 lots used in alternate firings with M1 and M8.

Some evidence for the insulation by low-flame temperature propellants in guns may be found by examining heat input with different "cleanout" rounds. If the heat input for the M392 round (M30 propellant) with an M467 cartridge (M1 propellant) as cleanout round reflects the contribution from the oxide deposit left by the M467 round, then the M392 cartridge should have higher heat input if the cleanout round were an M392 round without additive or an M392 round with polyurethane foam. Each of these rounds is more erosive than the M467 cartridge, hence each should leave a thinner oxide. The first experiments to measure heat input of 105-mm tank rounds did use M392 rounds minus TiO<sub>2</sub>-wax additive as cleanout rounds, but the thermocouples were not in the same axial location as in the second test.<sup>6</sup> One can use data from rounds common to both tests to estimate heat input. Table 8 summarizes the heat transfer results where one first notes that total heat input decreases as one goes downbore. One would expect the heat input from an M392A2 round following an M392 round (no additive) to be higher than an M392A2 following an M467. The heat input for the M392 cleanout round is higher at 641mm RFT.

<sup>6</sup>T.L. Brosseau and J.R. Ward, "Reduction of Heat Transfer in 105-mm Tank Gun by Wear-Reducing Additives. BRL Memorandum Report No. 2698, November 1976.

TABLE 8. EFFECT OF CLEANOUT ROUND ON HEAT INPUT FROM M392 CARTRIDGE\*

<u>Cartridge</u>	<u>Additive</u>	<u>Cleanout Round</u>	<u>Heat Input, J/mm</u>		
			<u>641mm**</u>	<u>667mm***</u>	<u>1,010mm***</u>
M392A1	none	none	449	426	359
M392A2	polyurethane foam	none	416	401	342
M392A2	TiO <sub>2</sub> -wax	M392 no additive	---	380	321
M392A2	TiO <sub>2</sub> -wax	M467TP-T	381	---	---

\* Axial distances measured from rear face of tube

\*\* Reference 3

\*\*\* Reference 5

Another opportunity to test the effect of previous rounds on heat input was in the evaluation of wear-reducing additives for the 105-mm tank cannon where rounds without wear-reducing liners were used as "cleanout" rounds along with M467 TP-T cartridges. The pertinent data are listed in Table 9 where the heat input effect is reflected as the peak temperature of the thermocouple nearest the bore surface. The peak temperature for the M392A2 and the M490 cartridges, both with M30 propellant, was higher following a "no liner" cleanout round vs. the M467 TP-T (M1 propellant) cartridge.

TABLE 9. EFFECT OF CLEANOUT ROUND ON HEAT INPUT

<u>Round</u>	<u>Temperature Rise, K</u>	<u>Cleanout Round, Propellant</u>
M392A2	157	M490 (no liner), M30
M392A2	150	M467, M1
M490	182	M490 (no liner), M30
M490	174	M490 (no liner), M30
M490	167	M467, M1

The failure to see any change in wear for M5 and M30 propellants in the blow out gun, regardless of the propellant used on the previous shot, implies the difference in oxide thickness is not sufficiently thick to change the heat transfer rate to affect wear. An analogous situation illustrating this point

<sup>7</sup>I.C. Stobie, T.L. Brosseau, and R.P. Kaste, "Heat Transfer Measurements in 105 mm Tank Gun with M735 Rounds," Technical Report ARBRL-TR-02265, September 1980.

involved a Navy experiment in which rounds were shot with three propellants having flame temperatures ranging from 2,100 to 3,000 K.<sup>8</sup> Charge weights were adjusted to give equivalent interior ballistics. Rounds were fired without wear-reducing additive and repeated with additive. Presumably, the oxide layer deposited was equivalent for each propellant, yet the change in wear was most dramatic for the 3,000 K propellant and not even measureable for the 2,100 K propellant.

Heat input could be used to determine which combination of rounds produces the most wear. For rounds with a wear-reducing additive depositing an insulating residue, the insulating residue from repeated firings of either TiO<sub>2</sub>-wax additive of M1 propellant is not formed. Niiler, et al, recently showed the oxide from M1 propellant builds on repeated firing much like the residue from the TiO<sub>2</sub>-wax liner.

#### IV. CONCLUSIONS

1. Gun barrel wear from propellant combustion gases is affected by the oxide left on the surface by the previous shot. The oxide acts as an insulator. Since the oxide thickness varies inversely with propellant flame temperature, wear increases following a shot with a higher flame-temperature propellant and decreases following a shot with a lower flame-temperature propellant.
2. The EFC factors determined from conventional gun wear tests where a given round is fired repeatedly will not predict wear when rounds with different flame temperatures are fired in combination.
3. Limited analysis of heat transfer results in the M68 tank cannon suggests the heat input is sensitive to the previous round. This suggests that the oxide layer influences wear in guns and heat input measurements can be used to determine what combination of rounds produces the worst wear.

---

<sup>8</sup>M.C. Shamblen, "Overview of Erosion in US Naval Guns," Proceedings of the Tri-Service Gun Tube Wear and Erosion Symposium, Dover, NJ, March 1977.

<sup>9</sup>A. Niiler, et al, report in preparation.

## REFERENCES

1. A. Niiler, J.E. Youngblood, S.E. Caldwell, and T.J. Rock, "An Accelerator Technique for the Study of Ballistic Surfaces," BRL Report No. 1815, August 1975.
2. A. Niiler and R. Birkmire, "Composition Changes in Gun Steel Surfaces Due to Erosive Propellant Burn," Proceedings of the Tri-Service Gun Tube Wear and Erosion Symposium, Dover, NJ, March 1977.
3. E. Freedman, "BLAKE-A Ballistic Thermodynamic Code Based on TIGER," Proceedings of the International Symposium on Gun Propellants, Picatinny Arsenal Dover, NJ, October 1973.
4. J.R. Ward and R.W. Greene, "Erosivity of a Nitramine Propellant with a Flame Temperature Comparable to M30 Propellant," BRL Memorandum Report No. 02926, June 1979.
5. J.R. Ward and T.L. Brosseau, "Role of the Insulating Layer From TiO<sub>2</sub>-Wax Liner in Reducing Gun Tube Wear," Proceedings of the 1980 JANNAF Propulsion Meeting, CPIA Publication 315, March 1980.
6. T.L. Brosseau and J.R. Ward, "Reduction of Heat Transfer in 105-mm Tank Gun by Wear-Reducing Additives," BRL Memorandum Report No. 2698, November 1976.
7. I.C. Stobie, T.L. Brosseau, and R.P. Kaste, "Heat Transfer Measurements in 105-mm Tank Gun With M735 Rounds," Technical Report ARBRL-TR-02265, September 1980.
8. M.C. Shamblen, "Overview of Erosion in US Naval Guns," Proceedings of the Tri-Service Gun Tube Wear and Erosion Symposium, Dover, NJ, March 1977.
9. A. Niiler, et al, report in preparation.

**APPENDIX A**

**COMPILED OF WEAR DATA**

TABLE A-1. MASS LOSS FOR M8 (REPETITIVE FIRE)

<u>ID</u>	<u>Nozzle</u>	<u>Charge Mass, g</u>	<u>Pressure, MPa</u>	<u>Mass Loss, mg</u>
11	8*	68.4	**	236.1
14	8	68.4	228	230.1
16	8	68.4	234	228.8
19	8	68.4	234	253.0
22	8	68.4	228	265.0
24	8	68.4	228	230.0

---

*\* New Nozzle**\*\*Not recorded*

TABLE A-2. MASS LOSS FOR M30 PROPELLANT (REPETITIVE FIRE)\*

<u>ID</u>	<u>Nozzle</u>	<u>Charge Mass, g</u>	<u>Pressure, MPa</u>	<u>Mass Loss, mg</u>
25	T	72.2	241	7.6
28	T	72.2	248	16.5
31	T	72.2	241	12.3
34	T	72.2	241	8.1
37	T	72.2	241	11.9
39	T	72.2	241	9.1
41	T	72.2	241	9.9
75	58	72.2	**	4.6
78	58	72.2	**	3.0
81	58	72.2	**	4.7
84	58	72.2	**	2.3
86	58	72.2	**	5.3
89	58	72.2	**	3.7

---

*\* ID 24-41 is M30 propellant used with M8 tests. ID 75-89 is M30 propellant used with M1 tests.**\*\* Maximum chamber pressures not recorded.*

TABLE A-3. MASS LOSS FOR M1 PROPELLANT (REPETITIVE FIRE)

<u>ID</u>	<u>Nozzle</u>	<u>Charge Mass, g</u>	<u>Pressure, MPa</u>	<u>Mass Loss, mg</u>
71	5	80.09	234	1.5
74	5	80.09	*	1.1
77	5	80.09	228	1.5
80	5	80.09	*	0.8
83	5	80.09	*	0.6

\*Chamber pressure not recorded.

TABLE A-4. MASS LOSS ALTERNATING M8 WITH M30, M5, OR M1 PROPELLANT

<u>ID</u>	<u>Nozzle</u>	<u>Propellant</u>	<u>Charge Mass, g</u>	<u>Pressure, MPa</u>	<u>Mass Loss, mg</u>
12	58*	M8	68.4	**	299.2
15	58	M5	72.8	234	52.5
18	58	M8	68.4	234	221.1
21	58	M5	72.8	234	45.2
23	58	M8	68.4	228	222.8
26	58	M5	72.8	234	48.2
30	58	M8	68.4	**	214.0
33	58	M30	72.2	**	18.8
36	58	M8	68.4	221	213.8
28	8	M30	72.2	228	7.4
31	8	M8	68.4	234	225.2
34	8	M30	72.2	221	10.8
51	8	M1	80.09	234	1.6
54	8	M8	68.4	228	207.0
57	8	M1	80.09	228	4.3
60	8	M8	68.4	228	208.9
63	8	M1	80.09	234	4.4
66	8	M8	68.4	228	183.0
69	8	M1	80.09	228	2.8

\* New nozzle

\*\* Not recorded

TABLE A-5. MASS LOSS ALTERNATING M1, M5, OR M30 PROPELLANT

<u>ID</u>	<u>Nozzle</u>	<u>Propellant</u>	<u>Charge Mass, g</u>	<u>Pressure, MPa</u>	<u>Mass Loss, mg</u>
50*	5	M1	80.09	234	4.9
53	5	M5	72.8	248	40.7
56	5	M1	80.09	234	1.9
59	5	M5	72.8	234	46.6
62	5	M1	80.09	234	1.3
65	5	M5	72.8	234	45.2
68	5	M1	80.09	234	1.5
51**	8	M1	80.09	234	1.6
52***	58	M1	80.09	228	4.4
55	58	M30	72.2	228	5.4
58	58	M1	80.09	214	1.2
61	58	M30	72.2	221	5.6
64	58	M1	80.09	228	0.4
67	58	M30	72.2	****	4.0
70	58	M1	80.09	234	1.5
72	58	M30	72.2	****	7.1

\* Previous shot on nozzle 5 was M5 propellant (ID 35)

\*\* Previous shot on nozzle 8 was M30 propellant (ID 34)

\*\*\* Previous shot on nozzle 58 was M8 propellant (ID 36)

\*\*\*\* Not recorded

**DISTRIBUTION LIST**

<u>No. Of Copies</u>	<u>Organization</u>	<u>No. Of Copies</u>	<u>Organization</u>
12	Administrator Defense Technical Info Center ATTN: DTIC-DDA Cameron Station Alexandria, VA 22314	5	Commander USA ARRADCOM ATTN: DRDAR-LC J. Frasier J. Lannon A. Bracuti A. Moss R. Walker Dover, NJ 07801
1	Director of Defense Research and Engineering ATTN: R. Thorkildsen The Pentagon Washington, DC 20301	5	Commander USA ARRADCOM ATTN: DRDAR-LC E. Barrieres R. Corn D. Downs K. Rubin K. Russell Dover, NJ 07801
1	Defense Advanced Research Projects Agency Director, Materials Division 1400 Wilson Blvd. Arlington, VA 22209		Commander USA ARRADCOM ATTN: DRDAR-QA, J. Rutkowski Dover, NJ 07801
3	HQDA (DAMA-ARZ, DAMA-CSM, DAMA-WSW) Washington, DC 20301	1	Commander US Army Armament Materiel Readiness Command ATTN: DRSAR-LEP-L, Tech Lib Rock Island, IL 61299
1	Commander USA DARCOM ATTN: DRCDMD-ST 5001 Eisenhower Avenue Alexandria, VA 22333	1	Commander US Army Armament Readiness Command ATTN: DRSAR-ASR DRSAR-LEA DRSAR-QAL Rock Island, IL 61299
2	Commander USA ARRADCOM ATTN: DRDAR-TSS Dover, NJ 07801	3	Commander USA ARRADCOM Benet Laboratory ATTN: I. Ahmad T. Davidson G. Friar P. Greco M. Kamdar J. Zweig Watervliet, NY 12189
5	Commander USA ARRADCOM ATTN: DRDAR-SC T. Hung H. Kaln B. Brodman S. Cytron DRDAR-TDC D. Gyorog Dover, NJ 07801	6	Commander USA ARRADCOM Benet Laboratory ATTN: I. Ahmad T. Davidson G. Friar P. Greco M. Kamdar J. Zweig Watervliet, NY 12189

**DISTRIBUTION LIST**

<u>No. Of Copies</u>	<u>Organization</u>	<u>No. Of Copies</u>	<u>Organization</u>
6	Commander USA ARRADCOM Benet Laboratory ATTN: J. Busuttil W. Austin R. Montgomery R. Billington J. Santini DRDAR-LCB-TL Watervliet, NY 12189	1	Commander US Army Missile Command ATTN: DRSMI-YDL Redstone Arsenal, AL 35898
1	Commander US Army Aviation Research and Development Command ATTN: DRDAV-E 4300 Goodfellow Blvd. St. Louis, MO 63120	1	Commander US Army Tank Automotive Rsch and Development Command ATTN: DRDTA-UL Warren, MI 48090
1	Director US Army Air Mobility Research and Development Laboratory Ames Research Center Moffett Field, CA 94035	1	President US Army Armor & Engineer Bd Ft. Knox, KY 40121
1	Director US Army Research & Technology Laboratories (AVRADCOM) ATTN: R.A. Langsworth Ft. Eustis, VA 23604	1	Projects Manager, M60 Tanks US Army Tank & Automotive Cmd Warren, MI 48090
1	Commander US Army Communications Rsch and Development Command ATTN: DRDCO-PPA-SA Fort Monmouth, NJ 07703	3	Project Manager Cannon Artillery Weapons Systems ATTN: DRCPM-CAWS USA ARRADCOM Dover, NJ 07801
1	Commander US Army Electronics Research and Development Command Technical Support Activity ATTN: DELSD-L Fort Monmouth, NJ 07703	2	Project Manager ATTN: J. Turkeltaub S. Smith Rock Island, IL 61299
1	Commander US Army Missile Command ATTN: DRSMI-R Redstone Arsenal, AL 35898	1	Program Manager - M1 Abrams Tank System ATTN: DRCPM-GCM-S Warren, MI 48090
1		1	Project Manager Tank Main Armament ATTN: A. Albright Dover, NJ 07801
1		1	Project Manager, ARGADS Dover, NJ 07801

**DISTRIBUTION LIST**

<u>No. Of Copies</u>	<u>Organization</u>	<u>No. Of Copies</u>	<u>Organization</u>
3	Director US Army Research Office ATTN: P. Parish E. Saibel D. Squire P.O. Box 12211 Rsch Triangle Park, NC 27709	2	Commander Naval Ordnance Station, Louisville ATTN: F. Blume Louisville, KY 40202
2	Director US Army Materials & Mechanics Research Center ATTN: J.W. Johnson K. Sheppard Watertown, MA 02172	2	AFATL (D. Uhrig, O. Heiney) Eglin AFB, FL 32542
1	Commander US Army DARCOM Material Readiness Support Activity ATTN: DRXMD-ED Lexington, KY 40511	1	National Bureau of Standards Materials Division ATTN: A.W. Ruff Washington, DC 20234
1	Director US Army TRADOC Systems Analysis Activity ATTN: ATAA-SL, Tech Lib WSMR, NM 88002	1	National Science Foundation Materials Division 1800 G St., NW Washington, DC 20550
1	Commander US Army Air Defense Center ATTN: ATSA-SM-L Ft. Bliss, TX 79916	1	Battelle Memorial Institute ATTN: G. Wolken Columbus, OH 43201
1	Commander US Army Armor Center & School ATTN: ATZK-XM1 Ft. Knox, KY 40121	1	Lawrence Livermore Laboratory ATTN: J. Kury P.O. Box 808 Livermore, CA 94550
1	Commander USA Field Artillery School Ft. Sill, OK 73503	2	Calspan Corporation ATTN: G. Sterbutzel F. Vassallo P.O. Box 400 Buffalo, NY 14225
5	Commander Naval Surface Weapons Center ATTN: M. Shamblen J. O'Brasky C. Smith L. Russell T.W. Smith Dahlgren, VA 22448	1	Director Materials Engineering & Tech GPD P&WA Group, UTC P.O. Box 2691 West Palm Beach, FL 33402
		1	Director Chemical Prop Info Agency Johns Hopkins University ATTN: T. Christian Johns Hopkins Road Laurel, MD 20707

**DISTRIBUTION LIST**

<u>No. Of Copies</u>	<u>Organization</u>	<u>No. Of Copies</u>	<u>Organization</u>
1	Princeton University Foresstal Campus Library ATTN: Tech Lib B. Royce P.O. Box 710 Princeton, NJ 08540	<u>Aberdeen Proving Ground</u>	
		Dir, USAMTD	ATTN: H. Graves, Bldg. 400
			C. Lavery, Bldg. 400
			L. Barnhart, Bldg 400
			K. Jones, Bldg. 400
			R. Moody, Bldg. 525
1	Purdue University School of Mechanical Engineering ATTN: J.R. Osborn W. Lafayette, IN 47907	Cdr, TECOM	ATTN: DRSTE-FA
			DRSTE-AR
			DRSTE-AD
			DRSTE-TO-F
1	SRI International Materials Research Center 333 Ravenswood Avenue Menlo Park, CA 94025	Dir, USAMSA	ATTN: DRXSY-D
			DRXSY-MP, H. Cohen
			D. Barnhart, RAM Div
			G. Alexander, RAM Div
			Air Warfare Div
			Ground Warfare Div
			RAM Division
1	University of Illinois Dept. of Mechanical Engineering ATTN: H. Krier 144 MEB, 1206 W. Green St. Urbana, IL 61801	Dir, USACSL, Bldg. E3516, EA	ATTN: DRDAR-CLB-PA

### USER EVALUATION OF REPORT

Please take a few minutes to answer the questions below; tear out this sheet, fold as indicated, staple or tape closed, and place in the mail. Your comments will provide us with information for improving future reports.

1. BRL Report Number \_\_\_\_\_

2. Does this report satisfy a need? (Comment on purpose, related project, or other area of interest for which report will be used.)  
\_\_\_\_\_  
\_\_\_\_\_

3. How, specifically, is the report being used? (Information source, design data or procedure, management procedure, source of ideas, etc.)  
\_\_\_\_\_  
\_\_\_\_\_

4. Has the information in this report led to any quantitative savings as far as man-hours/contract dollars saved, operating costs avoided, efficiencies achieved, etc.? If so, please elaborate.  
\_\_\_\_\_  
\_\_\_\_\_

5. General Comments (Indicate what you think should be changed to make this report and future reports of this type more responsive to your needs, more usable, improve readability, etc.)  
\_\_\_\_\_  
\_\_\_\_\_

6. If you would like to be contacted by the personnel who prepared this report to raise specific questions or discuss the topic, please fill in the following information.

Name: \_\_\_\_\_

Telephone Number: \_\_\_\_\_

Organization Address:  
\_\_\_\_\_  
\_\_\_\_\_